



Z CORPORATION*

Z Corporation
32 Second Avenue
Burlington, MA 01803
USA
Tel: +1-781-852-5005 (main)
Fax: +1-781-852-5100

User Guide

zp[®] 150 High Performance Composite

Description

zp150 is a High Performance Composite material for making strong, high-definition parts. It features great green strength right out of the printer, improved final strength and because the material is so white, 3D models printed with zp150 feature vivid color. Additionally, zp150 features a new Water Cure finishing option. Simply spray your 3D-printed model with a fine mist of water mixed with salt, dry it, and it's ready to be shown and touched.

zp150's performance improvements and the new Water Cure option make it a truly versatile printing material. Use Water Cure for early concept iterations and ergonomics tests, and then finish your new designs with Z-Max™ for functional testing.

Features

The unique features of zp150 include the following:

Best Color and Whiteness

- Brightest whites - 90% whiter than zp131*
- Largest color gamut ever – 125% larger than zp131
- New HD color printing mode for the ZPrinter[®] 650

Highest strength

- Better green strength than zp130 and zp131 for easier processing
- 40% stronger with Z-Bond™ 101 over zp130
- 100% stronger with Water Cure over zp140

New finishing option - Water Cure with Epsom Salt

- Easy and user-friendly post-processing option – only water and salt are required to seal and strengthen your printed parts
- Works with color models for draft color

Great Versatility – One powder for all applications

- Compatible with Water Cure, Wax, Z-Bond and Z-Max – something for every application



* Compared to zp131 with Z-Bond 101. zp150 is 300% whiter compared to zp130. Per CIE Whiteness Index.



Applications

zp150 is a multi-purpose material system and can be used for many applications such as:

- Concept Modeling
- Ergonomic Testing
- Presentation Models
- Sales Demonstration Models
- Functional evaluation models
- Rapid tooling

Compatibility

The following binders and printers are currently qualified for use with zp150. We're always testing new materials and combinations, so check our Web site for the latest information: zcentral.zcorp.com.

3D Printers

At this time, zp150 is qualified exclusively for use on the ZPrinter 450 and on the ZPrinter 650.

Binders

ZPrinter 450: use only with zb63 binder.

ZPrinter 650: use only with zb61 binders.

Infiltrants

- Z-Bond 101
- Z-Bond 90
- Z-Max
- Wax

Water Cure

Water Cure is compatible with all parts made with zp150 when using Epsom Salt (see Appendix).

Color parts are best finished using Z-Bond 101 or Z-Bond 90. Water cure with Epsom Salt can be used on color parts, but the colors will remain muted.



Storage and Shelf Life

- zp150 powder should be stored in a cool, dry, ventilated area away from sources of heat and moisture. Container should be kept tightly capped.
- Binders should be stored in a cool, dry environment.
- A cartridge of clear or color binder has a shelf life of 1 year from the date of manufacture.

Quantities Available

Get pricing information and purchase zp150 and associated binders via the Z-Shop Web site at: zshop.zcorp.com

ZPrinter 450

| Material | Medium | Quantity |
|-------------------|-----------|----------------|
| zp150 Powder | Cartridge | 8 kg |
| | Eco Drum | 14 kg |
| zb63 Clear binder | Cartridge | 1.0 L (pkg. 2) |

ZPrinter 650

| Material | Medium | Quantity |
|-----------------------------------------------|-----------|----------------|
| zp150 Powder | Cartridge | 8 kg |
| | Eco Drum | 14 kg |
| zb61 Clear binder | Cartridge | 1.0 L (pkg. 2) |
| zb61 Black binder | Cartridge | 1.0 L (pkg. 2) |
| zb61 Color binders (Cyan, Magenta, Yellow) | Cartridge | 0.3 L (pkg. 2) |

Instructions for Use

Software:

zp150 requires ZPrint™ 7.9 or higher and these respective firmware versions:

ZPrinter 450: v4.154 or higher.

ZPrinter 650: v5.233 or higher.



Changeover:

Changing over from one material to another is a simple process. For detailed instructions, please refer to your 3D printer's Materials Changeover Instructions included with your zp150 Upgrade Kit. These instructions are also available on our Web site (zcentral.zcorp.com).

After changing over, remember to set zp150 as your new default powder in ZPrint. Select **Settings > Powder Settings**, highlight ZP150 and select **Set As Default Powder**.

Processing:

Most parts can be removed from the build chamber as soon as the drying cycle is completed. For best appearance, parts should be removed from the build chamber within 24 hours. If your 3D model has thin, fragile features, allow it to dry for another hour in the printer, or in a 40-60°C convection oven for approximately two hours.

Infiltration:

After your 3D model is dry and fine depowdered, it can be infiltrated. When high strength is not critical, Water Cure is a quick, easy way to finish parts. The best concept models are made when using Z-Bond 101 or Z-Bond 90. Z-Max Epoxy will confer superior strength for functional models. For more information on the Water Cure procedure, please refer to the Appendix of this guide.

Sanding:

Parts can be sanded to improve the surface finish. Start with 100-grit paper and continue to 220-grit if a smoother finish is desired.

Painting:

Parts printed with zp150 can be painted with most commonly available paints and coatings without additional processing. For the best surface finish, sand lightly, use a primer, and then apply paint.

Bonding/Joining:

For information on bonding or joining parts together, please refer to the *Bonding Parts Guide*.

Related Documents/Links

- Water Cure with Epsom Salt Instructions – see Appendix
- Materials Changeover Instructions – provided in zp150 Upgrade Kit; also on our Web site (zcentral.zcorp.com).
- MSDS – on our Web site (zcentral.zcorp.com).

Contact Information

Questions? Contact us at service@zcorp.com.

Appendix

Instructions - Water Cure With Epsom Salt

Description

Water cure with Epsom salt is the best way to finish concept models quickly and easily. No hazardous or restricted chemicals are involved: simply dissolve the Epsom salt into tap water and spray a fine mist over the surface of your parts to give them a smooth, hard surface and a bright white appearance.

The Water Cure with Epsom salt method applies to all parts printed using zp150 or zp140 powder.

Water Cure with Epsom salt can be used on color parts but colors will remain slightly muted.



Model finished with Water Cure

Spraying vs. Dipping

IN MOST CASES, SPRAYING IS STRONGLY RECOMMENDED: it is quicker and easier than dipping. Dipped parts require a large amount of salted water to be prepared and longer drying after dipping. Dipping does not provide added strength.

In cases where complete penetration of thick sections is desired, the dipping method should be used.

Handling and Usage Information

- The salt used in this procedure must be magnesium sulfate heptahydrate. In most countries this is sold as Epsom Salt. Do NOT use any other type of salt.
- For storage & handling precautions of the dry salt, refer to the Epsom Salt package or consult your salt supplier.
- While mixing the salt solution and finishing parts, we recommend wearing gloves and safety goggles.




Set Up the Work Area

- Place a clean sheet of non-stick material (Teflon, freezer paper or wax paper) on your work area for easy clean-up and to put your parts on as they dry.
- Add a layer of paper towels where your model(s) will be placed to wick excess salt water away from your model
- **Tip:** Have a sheet of the non-stick material on a tray so parts can be safely moved while they dry.
- For spraying, you will need a spray bottle (supplied with your starter kit or your upgrade kit).
- For dipping, you will need a sturdy, clean, water-tight container (example: plastic, glass) and a graduated container or some other means of measuring volume of water and salt.

Spraying method


Prepare the Salt Solution

1. Remove the spray head from the spray bottle supplied by Z Corp.
2. Fill with Epsom salt up to the 7 oz line.

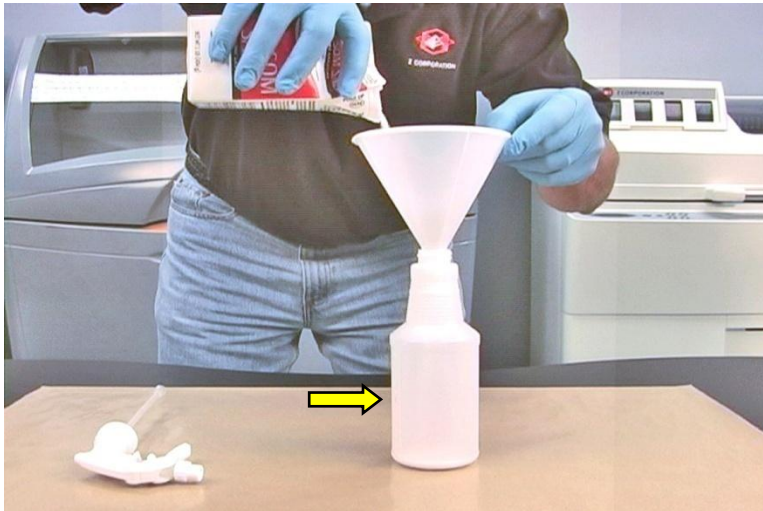

3. Add tap water until you reach the 16 oz line.

Tip: Using warm water helps the salt dissolve faster.

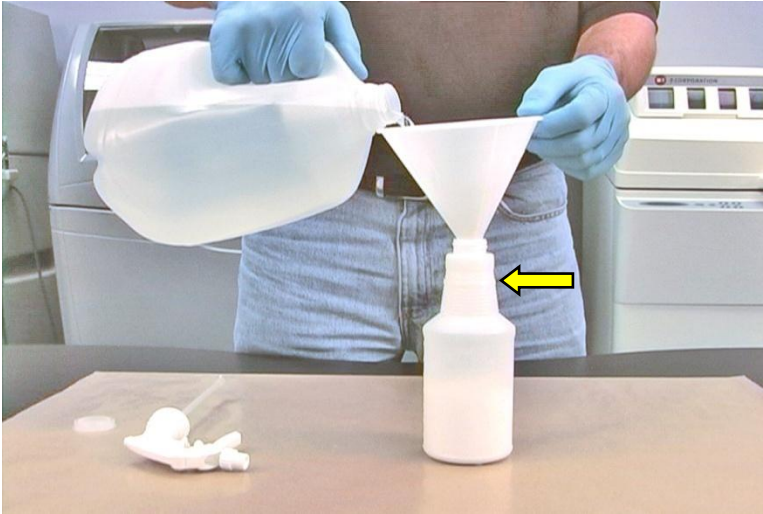

4. Note: if you're using a different spray bottle, use the mixing ratios provided in the dipping section of this document.
5. Replace the spray head, close it tightly and shake for 1-2 minutes.
6. If there are still undissolved crystals at the bottom, allow 30-60 minutes to dissolve and shake for 1 more minute.



7. Once all the crystals are dissolved, test the spraying and adjust it to a fine mist using the spray knob.

Note: If the salt has not dissolved completely, you may experience poor spraying performance. If the amount of salt mixed in is incorrect, the salt solution may be too dilute and parts may become weak during spraying

Spray the part

1. Place your part on a flat surface coated with paper towels or wax paper.

Tip: Spread extra towels or paper around the area to catch any overspray. This will make cleanup easier. Overspray can be wiped up with a damp sponge or cloth.

2. *Lightly* coat one side of your part with a fine mist from a distance of one to two feet (30-50 cm). **DON'T TRY TO SATURATE THE SURFACE** – just a light misting is good. Make sure the entire side is coated. Avoid touching the part where it has been sprayed.



3. Carefully turn the part and coat the other side with a similar fine mist.

Note: Fine structures/protrusions may be delicate. Over-saturating with water may cause drooping/breakage of such fine structures.

4. Let the part air dry for at least 5 minutes before moving it.

Tip: A fan or hair dryer can be used to harden the surface layers more rapidly. This allows for quicker handling. Note the part may still be weak, so handle with care.




Dry the Part

- Allowed to air dry at room temperature, the part will be dried to touch within a couple hours and fully dried within 24 - 48 hours.
- For faster drying, the parts can be placed in an oven set to 70°C for 1-2 hours. This also helps guarantee maximum whiteness of the parts. Drying time may vary depending on your oven and the size of your models.

Note: If you dry your models at room temperature, a pattern may appear on your parts after several days. See photo to the right (contrast has been exaggerated to make it more visible).

This may be prevented or removed from a part by drying it for 1-2 hours at 70°C.

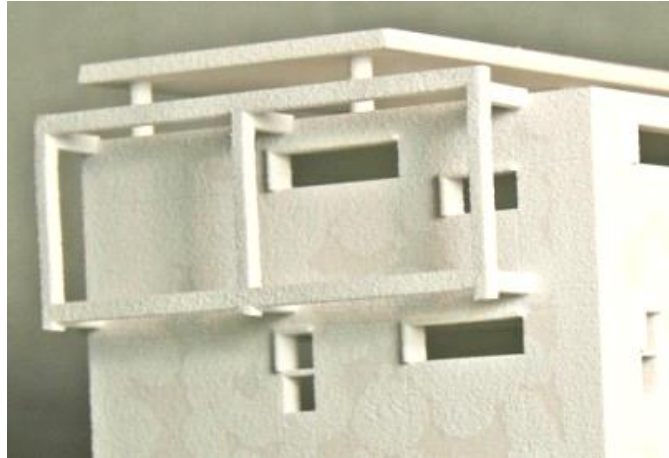

Dipping method

Prepare the Salt Solution

1. Measure enough tap water into the container to submerge your part completely and allow room for handling.
2. Allow room in the container for the volume of salt and for the water that will be displaced by your part.
3. For each 1 **volume** of water, add 0.7 **volume** of salt (see table below).

| Metric Units | | Imperial Units | |
|--------------|-------|----------------|--------------|
| Water | Salt | Water | Salt |
| 1 L | 0.7 L | 0.5 gal. | 45 oz |
| 2 L | 1.4 L | 1 gal. | 90 oz |
| 5 L | 3.5 L | 1.5 gal. | 1 gal. 6 oz |
| 10 L | 7 L | 2.5 gal. | 1 gal. 96 oz |

Note: If the amount of salt mixed in is incorrect, the salt solution may be too dilute and parts may become weak during spraying.

Tip: Using warm water helps the salt dissolve faster.



4. Stir the water solution intermittently until the salt completely dissolves (5-10 minutes). If there are any undissolved crystals at the bottom, allow 1-2 hours to dissolve, and then stir again for 1-2 minutes.

Note: Failure to dissolve all the salt could cause crystals to deposit onto your part when you dip it.

Dip the part

Tip: Wear gloves while dipping models to keep the bath clean and prevent mold growth.

1. Gently submerge the part in the bath for at least 5-10 seconds or until bubbles subside.
2. Slowly remove the part and hold it above the bath for 5-10 seconds to allow a majority of the excess water to run off. Rotate the part to help the water escape from any cavities or crevices.
3. Move the part to the paper towels and gently dab the bottom of it on the dry paper towels.

Tip: Avoid wiping the excess water on the top surfaces with a paper towel as this will compromise surface finish.

4. Place the dipped part on the wax paper and allow it to air dry for 1-2 hours before handling.

Tip: A fan or hair dryer can be used to harden the surface layers more rapidly. This allows for quicker handling. Note the parts may still be weak, so handle with care.

Dry the Part

- Allowed to air dry at room temperature, the part will be fully dried within 24 - 48 hours.
- For faster drying, the parts can be placed in an oven set to 70°C for 3-4 hours. This also helps guarantee maximum whiteness of the parts.

Clean up

- Any overspray is easily cleaned up with a wet cloth or sponge.
- The salt solution may be covered and reused for up to one week. Always check the solution before any subsequent uses - if the solution is cloudy or discolored in any way, discard it and make a fresh batch.
- The salt solution may be safely disposed of by pouring down a sink drain and flushing with plenty of water.

Contact Information

Questions? Contact us at applications@zcorp.com.